

Rev. 04/15/11

Carbon Dioxide (CO<sub>2</sub>) in air is normally measured in Parts Per Million (ppm). At 1,000 ppm CO<sub>2</sub>, one million air molecules would contain a mixture of 999,000 air molecules and 1,000 CO<sub>2</sub> molecules. The most common CO<sub>2</sub> sensors are known by the engineering term Non-Dispersive InfaRed, or NDIR. An NDIR CO<sub>2</sub> sensor shines infrared light through a gas sample in a sample chamber (see Figure 1). Sensitive photo-detectors measure the intensity of the infrared light after it passes through the gas sample. CO<sub>2</sub> molecules are opaque to 4.26 micron infrared light while the rest of the air molecules are not. So the intensity of the infrared light is diminished proportionally to the number of CO<sub>2</sub> molecules that are present. Measuring the resultant light intensity measures the number of CO<sub>2</sub> molecules present.

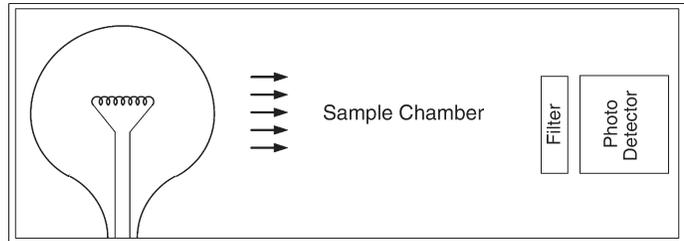


Figure 1: Single Channel CO<sub>2</sub> Sensor

## Sensor Drift

The most common light source for NDIR sensors is an incandescent light bulb. In these bulbs, an electric current passes through a metal filament and heats it until it starts to glow. The glowing filament is extremely hot and some of the metal atoms boil off the filament and fly around inside the bulb. Most of these atoms re-adhere to the filament when the power is turned off, but some move far enough away from the filament that they condense onto the glass envelope. Over time, this thin metal coating slightly reduces the amount of light emitted by the bulb. This reduction is perceived by the sensor as an increase in CO<sub>2</sub> concentration. Also, when the metal atoms condense back onto the filament, they can slowly shift the spectrum of the emitted light which can affect the perceived infrared light intensity and CO<sub>2</sub> concentration.

## Automatic Background Calibration

One way to compensate for sensor drift is through automatic background calibration. Outdoor levels of CO<sub>2</sub> are generally around 400 ppm. Since people are the main source of CO<sub>2</sub> inside a building, when a building is unoccupied for 4 to 8 hours the CO<sub>2</sub> levels tend to drop to the outside level. Automatic background calibration uses the sensor's on-board microprocessor to remember the lowest CO<sub>2</sub> concentration that occurs every 24 hours. The sensor assumes this low point is the outside CO<sub>2</sub> level. The sensor is also smart enough to discount periodic elevated readings that occur if a space is occupied for 24 hours a day over a few days. Once the sensor has collected 14 days worth of low CO<sub>2</sub> concentration periods, it performs a statistical analysis to see if there has been any small changes in the background levels readings that could be attributable to sensor drift. If the analysis concludes there is drift, a small correction factor is made to the sensor calibration to adjust for this change. This automatic calibration requires that at least three of the last 14 days have space CO<sub>2</sub> levels that reach 400 ppm for an hour or more.

## Reference Channel Calibration

Another way to compensate for sensor drift is through a dual channel design. In this setup, one photo-detector and filter is used for CO<sub>2</sub> measurement and works the same as in a single channel design. The second photo-detector and filter is a reference and uses a wavelength that is not affected by air molecules. About once a day, the sensor takes a reading using the reference channel. Any change in this reference measurement indicates a change in the optics of the sensor which can lead to drift. The sensor then automatically corrects the CO<sub>2</sub> measurement from the first channel to prevent the drift.

While the reference channel corrects for changes over time, a field calibration using nitrogen gas will immediately restore the highest level of accuracy. BAPI recommends a 5-year calibration interval for the average office environment.

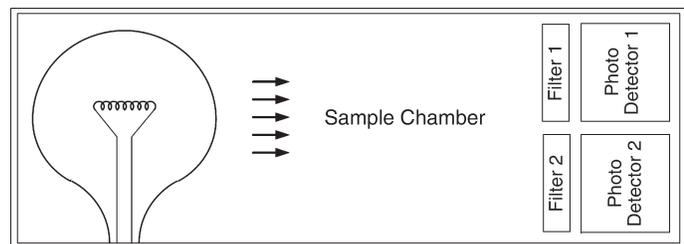


Figure 2: Dual Channel CO<sub>2</sub> Sensor